



Raba-Kistner Consultants, Inc.
800 E. Hackberry
McAllen, Texas 78501
(956) 682-5332 • FAX (956) 682-5487
www.rkci.com

Project No. ASF08-219-00
October 17, 2008

Mr. Eduardo Alcocer, AIA, Principal
Alcocer Garcia Associates – Design Group
1333 East Jasmine Avenue
McAllen, Texas 78501

**RE: Limited Survey for Asbestos Containing Materials
Old Hidalgo County Administration Building
1st, 2nd and 3rd Floors
100 East Cano Boulevard
Edinburg, Texas**

Dear Mr. Alcocer:

Raba-Kistner Consultants, Inc. (R-K) is pleased to submit the results of the asbestos survey for the above-referenced building. The purpose of this survey was to locate Asbestos Containing Material prior to the renovation activities in the interior areas of the subject building as reported by the CLIENT.

Should you have questions regarding this report or require additional information, please contact our office at your convenience.

Thank you for using **R-K** as your environmental consultants on the project. We appreciate the opportunity to be of service to you.

Very truly yours,

RABA-KISTNER CONSULTANTS, INC.

Alvaro Gurrola
Asbestos Inspector
License No. 205447

Michael P. Cosgrove
Asbestos Program Manager
TDH License No. 105473

AG/MPC/srw

Attachments

Copies Submitted: Above (2)

LIMITED ASBESTOS SURVEY

FOR

**OLD HIDALGO COUNTY ADMINISTRATION BUILDING
1ST, 2ND AND 3RD FLOORS
100 EAST CANO BOULEVARD
EDINBURG, TEXAS**

Prepared for

**ALCOCER GARCIA ASSOCIATES – DESIGN GROUP
McAllen, Texas**

Prepared by

**RABA-KISTNER CONSULTANTS, INC.
McAllen, Texas**

PROJECT NO. ASF08-219-00

October 2008

Raba-Kistner

Project No. ASF08-219-00
October 17, 2008

TABLE OF CONTENTS

PURPOSE AND SCOPE OF WORK.....	1
SURVEY METHODOLOGY.....	1
SURVEY RESULTS.....	1
RECOMMENDATIONS.....	2

ATTACHMENTS

Attachment A – Material Sampling Log
Attachment B – Laboratory Report of Analysis
Attachment C – R-K License and Certifications

PURPOSE AND SCOPE OF WORK

Raba-Kistner Consultants, Inc. (R-K) was retained by Mr. Eduardo Alcocer, AIA, Principal with Alcocer Garcia Associates – Design Group (CLIENT) to conduct a Limited Survey for asbestos containing material (ACM) to include the accessible interior building materials of the old Hidalgo County Administration building. The survey includes the 1st, 2nd and 3rd floor areas of both the south and north sections. The subject building is located at 100 East Cano Boulevard, Edinburg, Texas.

It should be noted that during its prime, asbestos was used in over 3000 different products and can still be found in some today. Attempts to locate and identify "all" asbestos was beyond the scope of this survey. Consequently, there may be materials and/or areas containing asbestos or other hazardous materials, which were inaccessible and require destructive sampling techniques to access.

SURVEY METHODOLOGY

R-K's sampling strategy was to locate homogeneous materials throughout the spaces outlined in this report and collect bulk samples of the suspect material for laboratory analysis for asbestos content. The term "homogeneous," as defined by EPA 40 CFR Part 763, means any material having the same color and texture and having been installed in the same general time period. The homogeneous materials were then assessed in terms of friability, condition, and quantity. The term "friable," as defined by EPA, means a material that when dry can be reduced to a powder using hand pressure. Prior to the collection of each bulk sample, any friable materials were properly wetted, and then all samples were carefully removed, and placed in small, self-locking containers. The containers were wiped, sealed, and labeled for transport to the laboratory. The Material Sampling Log is presented in Attachment A.

All samples were submitted for analysis to EMC Labs, Inc., which is accredited by the National Voluntary Accreditation Program (NVLAP) and licensed by the Texas Department of State Health and Services (TDSHS), formerly the Texas Department of Health, under License No. 30-0094. The bulk samples were analyzed by Polarized Light Microscopy (PLM) coupled with Dispersion Staining in accordance with the EPA method outlined in 40 CFR Part 763, Subpart F, Appendix A for determining asbestos in bulk samples. A copy of the laboratory analyses is presented in Appendix B.

SURVEY RESULTS

The EPA 40 CFR Part 763 defines ACM as any material or product that contains more than one percent asbestos. Based on the report of analyses, the below-mentioned material was tested and determined to be **Positive for asbestos content and are classified as Asbestos Containing Material**.

- **Wall Texture** (white) in west tax records vault room – 2% Chrysotile
- **Sink Undercoat**, (light pink) 1st and 2nd story sinks – 15% Chrysotile

- **9"X9" underlying floor tile** (off-white) / **Mastic** (black) throughout SE section of south building 1st & 2nd stories – 2% to 5% and 3% to 12% Chrysotile, respectively
- **Joint Compound** (beige) throughout south building 1st floor & 2nd story office area 206 walls – 2% Chrysotile
- **Mastic** (gray) on 2" joint in 2nd story room (ceiling) adj. to NE room – 10% Chrysotile
- **Mastic** (black) on AC duct joint wrap throughout south building ceiling – 10% Chrysotile
- **Mastic** (black) underlying 12" white floor tile in office area 202 (S. 2nd story) – 5% to 8% Chrysotile

The EPA 40 CFR Part 763 defines ACM as any material or product that contains more than one percent (1%) asbestos. Based on the report of analyses, all homogeneous materials sampled were determined to be **Negative (No asbestos containing materials)**:

- 2'X4' Ceiling tile, white/beige
- 2'X2' Ceiling tile, white/beige/gray
- Pipe wrap, white/beige/tan with silver coating
- 4" & 8" pipe wrap with white mastic
- 12"X12" Floor tile (white, off-white, blue gray, brown, pink & tan specs)
- Mastics, yellow/black underlying 12"X12" floor tile
- Wallboard
- Joint Compound
- Wall texture materials
- Spray-on ceiling texture
- Carpet mastic, yellow/light yellow
- Mud, white
- AC duct wrap
- AC joint tape/canvas on joint
- 4" Cove base mastic (yellow, brown, tan and black)
- Ventilation damper, black
- Sink Undercoat, white
- 1" wrap cloth

RECOMMENDATIONS

Currently, there are no regulations that require the removal or abatement of the ACM identified in this report unless the material would otherwise be disturbed by demolition, renovation, remodeling, or maintenance activities. Therefore, prior to any renovation activity of the subject areas within the subject building, a fully completed Renovation/Demolition Notification Form must be submitted to the Texas Department of State Health Services (TDSHS) at least ten (10) working days prior to such activity, including any asbestos abatement activities.

Please be advised that mandatory notification is required in accordance with section 295.61 of the Texas Asbestos Health Protection Act Rules (March 2003) for any demolition of a facility or public building, whether or not asbestos has been identified. Written notification must be postmarked at least 10 working days before the demolition begins.

Project No. ASF08-219-00
October 17, 2008

3

This notification shall be submitted on a form specified by the Texas Department of Health. Responsibility for proper notification is the facility owner and / or operator.

In the interim, personnel should be informed not to disturb these materials and include procedures to follow when these materials are anticipated to be impacted.

ATTACHMENTS



ATTACHMENT A

MATERIAL SAMPLING LOG

MATERIAL SAMPLING LOG

PROJECT NO.: ASF08-219-00 SAMPLED BY: Al Gurrola

CLIENT: Alcocer Garcia Associates LICENSE NO.: 205447

Old Hidalgo County Administration Building, 1st, 2nd & 3rd Floors, 100 East Cano Boulevard, Edinburg, Texas

DATE	SAMPLE NO.	SAMPLE LOCATION	MATERIAL SAMPLED	CATEGORY	CONDITION	RESULTS
9/24/08	1	Area behind teller's desk (north 1 st floor building)	A: 12"X12" Floor Tile (beige w- maroon, brown, blue specks B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/24/08	2	Office area on NE side	A: 12"X12" Floor Tile (beige w- maroon, brown, blue specks B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/24/08	3	NE corner offices	A: 12"X12" Floor Tile (beige w- maroon, brown, blue specks B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/24/08	4	Kitchen	A: 12"X12" Floor Tile, lt. brown w- brown specks B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/24/08	5	Dining room	A: 12"X12" Floor Tile, lt. brown w- brown specks B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/24/08	6	2 nd Story kitchen	A: 12"X12" Floor Tile, lt. brown w- brown specks B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/24/08	7	NE computer rooms (2)	A: 12"X12" Floor Tile (gray) B: Mastic, black	M	ND	A: None Detected B: None Detected
9/24/08	8	Kitchen, above ceiling	A: 12"X12" Floor Tile (gray) B: Mastic, black	M	ND	A: None Detected B: None Detected
9/24/08	9	Kitchen, above ceiling	A: 12"X12" Floor Tile (gray) B: Mastic, black	M	ND	A: None Detected B: None Detected
9/24/08	10	Center office room with round northwest corner	A: 12"X12" Floor Tile (lt. tan) B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/24/08	11	Storage room - west side of AC unit	A: 12"X12" Floor Tile (lt. tan) B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/24/08	12	Storage room - west side of AC unit	A: 12"X12" Floor Tile (lt. tan) B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/24/08	13	Round desk top	Counter Tops, tan	M	ND	None Detected
9/24/08	14	Round desk top	Counter Tops, tan	M	ND	None Detected
9/24/08	15	Round desk top	Counter Tops, tan	M	ND	None Detected

DATE	SAMPLE NO.	SAMPLE LOCATION	MATERIAL SAMPLED	CATEGORY	CONDITION	RESULTS
9/24/08	16	Throughout building – north section of building	2'X2' Ceiling Tile, white/beige with cut and dot indentations	M	ND	None Detected
9/24/08	17	Throughout building – mid north section	2'X2' Ceiling Tile, white/beige with cut and dot indentations	M	ND	None Detected
9/24/08	18	Throughout building – North office area	2'X2' Ceiling Tile, white/beige with cut and dot indentations	M	ND	None Detected
9/24/08	19	East column – east open area	A: Wall Board, tan B: J-Compound/texture, white	M	ND	A: None Detected B: None Detected
9/24/08	20	NE Office	A: Wall Board, tan B: J-Compound/texture, white	M	ND	A: None Detected B: None Detected
9/24/08	21	Office north of city comrs meeting room	A: Wall Board, tan B: J-Compound/texture, white	M	ND	A: None Detected B: None Detected
9/24/08	22	Throughout office west and south areas.	2'X4' Ceiling Tile, white/beige with cut and dot indentations	M	ND	None Detected
9/24/08	23	Throughout office west and south areas.	2'X4' Ceiling Tile, white/beige with cut and dot indentations	M	ND	None Detected
9/24/08	24	Throughout office west and south areas.	2'X4' Ceiling Tile, white/beige with cut and dot indentations	M	ND	None Detected
9/24/08	25	1st Story middle area	Ventilation Damper, black with white fibers	M	ND	None Detected
9/24/08	26	2nd Story – above ceiling	Ventilation Damper, black with white fibers	M	ND	None Detected
9/24/08	27	3 rd Story east side	Ventilation Damper, black with white fibers	M	ND	None Detected
9/24/08	28	West of mid information desk *ceiling*	A: 2" Paper Wrap, canvas tape B: Mastic, white	TSI	ND	A: None Detected B: None Detected
9/24/08	29	West of mid information desk *ceiling*	A: 2" Paper Wrap, canvas tape B: Mastic, white	TSI	ND	A: None Detected B: None Detected
9/24/08	30	West of mid information desk *ceiling*	A: 2" Paper Wrap, canvas tape B: Mastic, white	TSI	ND	A: None Detected B: None Detected
9/24/08	31	North mid side – ceiling	A: 6" Paper Wrap, canvas tape B: Mastic, white	TSI	ND	None Detected
9/24/08	32	North mid side – ceiling	A: 6" Paper Wrap, canvas tape B: Mastic, white	TSI	ND	None Detected
9/24/08	33	North mid side – ceiling	A: 6" Paper Wrap, canvas tape B: Mastic, white	TSI	ND	None Detected
9/24/08	34	Middle round columns	Mud, white	M	ND	None Detected
9/24/08	35	Middle round columns	Mud, white	M	ND	None Detected
9/24/08	36	Middle round columns	Mud, white	M	ND	None Detected

DATE	SAMPLE NO.	SAMPLE LOCATION	MATERIAL SAMPLED	CATEGORY	CONDITION	RESULTS
9/24/08	37	West tax records vault	A: Wall Mud, white B: Wall texture, white	M	ND	A: None Detected B: 3% Chrysothile
9/24/08	38	West tax records vault	A: Wall Mud, white B: Wall texture, white	M	ND	A: None Detected B: None Detected
9/24/08	39	West tax records vault	A: Wall Mud, white B: Wall texture, white	M	ND	A: None Detected B: None Detected
9/24/08	40	Kitchen adjacent to com. meeting room	A: 12"X12" Floor Tile (lt. gray) B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/24/08	41	Kitchen adjacent to com. meeting room	A: 12"X12" Floor Tile (lt. gray) B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/24/08	42	Kitchen adjacent to com. meeting room	A: 12"X12" Floor Tile (lt. gray) B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/24/08	43	Kitchen adjacent to com. meeting room	Sink Undercoat, light pink	M	ND	15% Chrysothile
9/24/08	44	UBC office (2 nd story)	Sink Undercoat, light pink	M	ND	15% Chrysothile
9/24/08	45	County judge office (2 nd Story)	Sink Undercoat, light pink	M	ND	15% Chrysothile
9/24/08	46	Throughout north building	A: 4" Cove base Mastic, yellow B: 4" Cove base Mastic, beige	M	ND	None Detected
9/24/08	47	Throughout north building	A: 4" Cove base Mastic, yellow B: 4" Cove base Mastic, beige	M	ND	None Detected
9/24/08	48	Throughout north building	A: 4" Cove base Mastic, yellow B: 4" Cove base Mastic, beige	M	ND	None Detected
9/24/08	49	County commissioners meeting room	Spray-On Ceiling texture, white	M	ND	None Detected
9/24/08	50	County commissioners meeting Room	Spray-On Ceiling texture, white	M	ND	None Detected
9/24/08	51	County commissioners meeting room	Spray-On Ceiling texture, white	M	ND	None Detected
9/24/08	52	NE office area – ceiling	A: 2" Paper Wrap, canvas tape B: Mastic, white	TSI	ND	A: None Detected B: None Detected
9/24/08	53	NE office area – ceiling	A: 2" Paper Wrap, canvas tape B: Mastic, white	TSI	ND	A: None Detected B: None Detected
9/24/08	54	NE office area – ceiling	A: 2" Paper Wrap, canvas tape B: Mastic, white	TSI	ND	A: None Detected B: None Detected
9/24/08	55	South section – middle storage office	A: 12"X12" Floor Tile (pink) B: Mastic, yellow C: 9"X9" Floor tile, off-white D: Mastic, black	M	ND	A: None Detected B: None Detected C: 3% Chrysothile D: 5% Chrysothile

DATE	SAMPLE NO.	SAMPLE LOCATION	MATERIAL SAMPLED	CATEGORY	CONDITION	RESULTS
9/24/08	56	SE stair area	A: 12"X12" Floor Tile (pink) B: Mastic, yellow C: 9"X9" Floor tile, off-white D: Mastic, black	M	ND	A: None Detected B: None Detected C: 3% Chrysothile D: 3% Chrysothile
9/24/08	57	SE Stairs storage	A: 12"X12" Floor Tile (pink) B: Mastic, yellow C: 9"X9" Floor tile, off-white D: Mastic, black	M	ND	A: None Detected B: None Detected C: 3% Chrysothile D: 3% Chrysothile
9/24/08	58	South section – middle storage office	A: Wall Board, tan B: Joint Compound, beige C: Texture, off-white	M	D	A: None Detected B: 2% Chrysothile C: None Detected
9/24/08	59	SE Stairs hall	A: Wall Board, tan B: Joint Compound, beige C: Texture, off-white	M	D	A: None Detected B: 2% Chrysothile C: None Detected
9/24/08	60	East mens restroom	A: Wall Board, tan B: Joint Compound, beige C: Texture, off-white	M	D	A: None Detected B: 2% Chrysothile C: None Detected
9/24/08	61	South section – north side offices	A: Wall Board, tan B: Joint Compound/texture, white	M	ND	A: None Detected B: None Detected
9/24/08	62	South section – north side offices	A: Wall Board, tan B: Joint Compound/texture, white	M	ND	A: None Detected B: None Detected
9/24/08	63	South section – north side offices	A: Wall Board, tan B: Joint Compound, beige C: Texture, off-white	M	ND	A: None Detected B: 2% Chrysothile C: None Detected
9/25/08	64	North section – middle office	Mastic, yellow	M	ND	None Detected
9/25/08	65	North Section – SECY.CDS	Mastic, yellow	M	ND	None Detected
9/25/08	66	North section – middle office	Mastic, yellow	M	ND	None Detected
9/25/08	67	2 nd Story walls – north wall	A: Wall Board, white B: Joint Compound/texture, white	M	ND	A: None Detected B: None Detected
9/25/08	68	2 nd Story – NE wall	A: Wall Board, white B: Joint Compound/texture, white	M	ND	A: None Detected B: None Detected
9/25/08	69	2 nd Story – mid office north wall	A: Wall Board, white B: Joint Compound/texture, white	M	ND	A: None Detected B: None Detected
9/25/08	70	2 nd Story – northeast ceiling area	A: 4" -6" Paper wrap, white/silver B: Mastic, white	TSI	ND	A: None Detected B: None Detected
9/25/08	71	2 nd Story – northeast ceiling area	A: 4" -6" Paper wrap, white/silver B: Mastic, white	TSI	ND	A: None Detected B: None Detected

DATE	SAMPLE NO.	SAMPLE LOCATION	MATERIAL SAMPLED	CATEGORY	CONDITION	RESULTS
9/25/08	72	2 nd Story – northeast ceiling area	A: 4" -6" Paper wrap, white/silver B: Mastic, white	TSI	ND	A: None Detected B: None Detected
9/25/08	73	2 nd Story – northeast ceiling area	A: 2" elbow paper wrap, white B: Mastic, white	TSI	ND	A: None Detected B: 10% Chrysotile
9/25/08	74	2 nd Story – northeast ceiling area	A: 2" elbow paper wrap, white B: Mastic, white	TSI	ND	A: None Detected B: 10% Chrysotile
9/25/08	75	2 nd Story – northeast ceiling area	A: 2" elbow paper wrap, white B: Mastic, white	TSI	ND	A: None Detected B: 10% Chrysotile
9/25/08	76	2 nd Story – kitchen adjacent to E. elevator	Sink Undercoat, white	M	ND	None Detected
9/25/08	77	2 nd Story – kitchen adjacent to E. elevator	Sink Undercoat, white	M	ND	None Detected
9/25/08	78	3 rd Story – kitchen	Sink Undercoat, white	M	ND	None Detected
9/25/08	79	2 nd Story – UC File storage rm, north side	A: 12"X12" Floor Tile (blue) B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/25/08	80	2 nd Story – UC File storage rm, north side	A: 12"X12" Floor Tile (blue) B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/25/08	81	2 nd Story – UC File storage rm, north side	A: 12"X12" Floor Tile (blue) B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/25/08	82	2 nd Story – UBC office	2'X2' Ceiling Tile, gray-rough texture	M	ND	None Detected
9/25/08	83	2 nd Story – UBC office	2'X2' Ceiling Tile, gray-rough texture	M	ND	None Detected
9/25/08	84	2 nd Story – UBC office	2'X2' Ceiling Tile, gray-rough texture	M	ND	None Detected
9/25/08	85	2 nd Story – west office bet. 2 secretaries offices	A: 2" Paper wrap, canvas tape B: Mastic, off-white	TSI	ND	A: None Detected B: None Detected
9/25/08	86	2 nd Story – west office bet. 2 secretaries offices	A: 2" Paper wrap, canvas tape B: Mastic, off-white	TSI	ND	A: None Detected B: None Detected
9/25/08	87	2 nd Story – west office bet. 2 secretaries offices	A: 2" Paper wrap, canvas tape B: Mastic, off-white	TSI	ND	A: None Detected B: None Detected
9/25/08	88	2 nd Story, south bldg section – throughout ceiling – AC duct	A: Mastic, black B: Silver Wrap	M	ND	A: 10% Chrysotile B: None Detected
9/25/08	89	2 nd Story – throughout ceiling – AC duct	A: Mastic, black B: Silver Wrap	M	ND	A: 10% Chrysotile B: None Detected
9/25/08	90	2 nd Story – throughout ceiling – AC duct	A: Mastic, black B: Silver wrap	M	ND	A: 10% Chrysotile B: None Detected

DATE	SAMPLE NO.	SAMPLE LOCATION	MATERIAL SAMPLED	CATEGORY	CONDITION	RESULTS
9/25/08	91	2 nd Story – columns throughout	A: Mud, white B: Toweled concrete, tan	T	ND	A: None Detected B: None Detected
9/25/08	92	2 nd Story – columns throughout	A: Mud, white B: Toweled concrete, tan	M	ND	A: None Detected B: None Detected
9/25/08	93	2 nd Story – columns throughout	A: Mud, white B: Toweled concrete, tan	M	ND	A: None Detected B: None Detected
9/25/08	94	2 nd Story – SE corner room	A: Wall Board, white B: Joint Compound/texture, fine/white	M	MD	A: None Detected B: None Detected
9/25/08	95	2 nd Story – SE hall	A: Wall Board, white B: Joint Compound/texture, fine/white	M	MD	A: None Detected B: None Detected
9/25/08	96	2 nd Story – Stair wall	A: Wall Board, white B: Joint Compound/texture, fine/white	M	MD	A: None Detected B: None Detected
9/25/08	97	2 nd Story – SE corner room	A: 4" cove base mastic, brown B: Mastic, tan	M	MD	None Detected
9/25/08	98	2 nd Story – E office	A: 4" cove base mastic, brown B: Mastic, tan	M	MD	None Detected
9/25/08	99	2 nd Story – south office renovation area	A: 4" cove base mastic, brown B: Mastic, tan	M	ND	None Detected
9/25/08	100	2 nd Story – south office renovation area(#206)	A: 12"X12" Floor Tile (brown) B: Mastic, yellow C: Mastic, black	M	SD	A: None Detected B: None Detected C: 5% Chrysofile
9/25/08	101	2 nd Story – SE corner wall (#206)	A: 12"X12" Floor Tile (brown) B: Mastic, yellow C: Mastic, black	M	SD	A: None Detected B: None Detected C: 8% Chrysofile
9/25/08	102	2 nd Story – SE office 206	A: 12"X12" Floor Tile (brown) B: Mastic, yellow C: Mastic, black	M	SD	A: None Detected B: None Detected C: 8% Chrysofile
9/25/08	103	2 nd Story – SE corner wall (#206)	A: Wall Board, tan B: Joint Compound, beige C: Texture, off-white	M	ND	A: None Detected B: 2% Chrysofile C: None Detected
9/25/08	104	2 nd Story – SE office (#206)	A: Wall Board, tan B: Joint Compound, beige C: Texture, off-white	M	ND	A: None Detected B: 2% Chrysofile C: None Detected
9/25/08	105	2 nd Story – SE corner wall (#206)	A: Wall Board, tan B: Joint Compound, beige C: Texture, off-white	M	ND	A: None Detected B: 3% Chrysofile C: None Detected

DATE	SAMPLE NO.	SAMPLE LOCATION	MATERIAL SAMPLED	CATEGORY	CONDITION	RESULTS
9/25/08	106	2 nd Story – SE office 202	A: 12"X12" Floor Tile (beige) B: Mastic, yellow/black C: 9" floor tile, off-white D: Mastic, black	M	SD	A: None Detected B: None Detected C: 3% Chrysotile D: 2% Tremolite
9/25/08	107	2 nd Story – SE office 206	A: 12"X12" Floor Tile (beige) B: Mastic, yellow/black C: 9" floor tile, off-white D: Mastic, black	M	SD	A: None Detected B: None Detected C: 3% Chrysotile D: 10% Chrysotile
9/25/08	108	2 nd Story – SE office 206	A: 12"X12" Floor Tile (beige) B: Mastic, yellow/black C: 9" floor tile, off-white D: Mastic, black	M	SD	A: None Detected B: None Detected C: 3% Chrysotile D: 2% Tremolite
9/25/08	109	2 nd Story – SW office rm.	4" cove base mastic, blk/brwn/tan	M	ND	None Detected
9/25/08	110	2 nd Story – SW hall	4" cove base mastic, blk/brwn/tan	M	ND	None Detected
9/25/08	111	2 nd Story – southeast mid office area	4" cove base mastic, blk/brwn/tan	M	ND	None Detected
9/25/08	112	2 nd Story – SW office	A: Wall Board, tan B: J-Compound/Texture, white	M	ND	A: None Detected B: None Detected
9/25/08	113	2 nd Story – SW hall	A: Wall Board, tan B: J-Compound/Texture, white	M	ND	A: None Detected B: None Detected
9/25/08	114	2 nd Story – SW office mid open hall	A: Wall Board, tan B: J-Compound/Texture, white	M	ND	A: None Detected B: None Detected
9/25/08	115	2 nd Story – mid hall area	A: 12"X12" Floor Tile (white) B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/25/08	116	3 rd Story – W office	A: 12"X12" Floor Tile (white) B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/25/08	117	3 rd Story – E. office	A: 12"X12" Floor Tile (white) B: Mastic, yellow	M	ND	A: None Detected B: None Detected
9/25/08	118	3 rd Story – west office	A: Wall Board, beige B: J-Compound, white C: Texture, white	M	ND	A: None Detected B: None Detected C: None Detected
9/25/08	119	3 rd Story – mid office	A: Wall Board, beige B: J-Compound, white C: Texture, white	M	ND	A: None Detected B: None Detected C: None Detected
9/25/08	120	3 rd Story – E. office	A: Wall Board, beige B: J-Compound, white C: Texture, white	M	ND	A: None Detected B: None Detected C: None Detected

DATE	SAMPLE NO.	SAMPLE LOCATION	MATERIAL SAMPLED	CATEGORY	CONDITION	RESULTS
9/25/08	121	3 rd Story – E. hall area	A: 8" Paper Wrap, white/silver B: Tape Canvas, off-white C: Mastic, white	TSI	ND	A: None Detected B: None Detected C: None Detected
9/25/08	122	3 rd Story – E. hall area	A: 8" Paper Wrap, white/silver B: Tape Canvas, off-white C: Mastic, white	TSI	ND	A: None Detected B: None Detected C: None Detected
9/25/08	123	3 rd Story – E. hall area	A: 8" Paper Wrap, white/silver B: Tape Canvas, off-white C: Mastic, white	TSI	ND	A: None Detected B: None Detected C: None Detected
9/25/08	124	3 rd Story – mechanical room	A: 4" -8" Paper Wrap, white/silver B: Tape Canvas, white C: Mastic, off-white	TSI	ND	A: None Detected B: None Detected C: None Detected
9/25/08	125	3 rd Story – mechanical room	A: 4" -8" Paper Wrap, white/silver B: Tape Canvas, white C: Mastic, off-white	TSI	ND	A: None Detected B: None Detected C: None Detected
9/25/08	126	3 rd Story – mechanical room	A: 4" -8" Paper Wrap, white/silver B: Tape Canvas, white C: Mastic, off-white	TSI	ND	A: None Detected B: None Detected C: None Detected
9/25/08	127	2 nd Story – SE hall column	A: Wall Board, beige B: J-Compound, white C: Texture, white	M	ND	A: None Detected B: None Detected C: None Detected
9/25/08	128	2 nd Story – SW hall column	A: Wall Board, beige B: J-Compound, white C: Texture, white	M	ND	A: None Detected B: None Detected C: None Detected
9/25/08	129	1 st Story – Access Hall, north wall	A: Wall Board, beige B: J-Compound, white C: Texture, white	M	ND	A: None Detected B: None Detected C: None Detected
9/25/08	130	1 st Story – SW Mechanical Room	1 st Story – SW Mechanical Room	M	D	None Detected
9/25/08	131	1 st Story – SW Mechanical Room	1 st Story – SW Mechanical Room	M	D	None Detected
9/25/08	132	1 st Story – SW Mechanical Room	1 st Story – SW Mechanical Room	M	D	None Detected

CATEGORY: S-Surface Sprayed-on or Troweled-on, T-Thermal, M-Miscellaneous (floor tile, ceiling tile, mastic, etc.)

CONDITION: ND-No Damage, MD-Minor Damage (small dents, tears), D-Damage (less than 3 sq. ft. of total area), SD-Significant Damage (greater than 3 sq. ft. of total area or heavy damage in local area)

ATTACHMENT B

LABORATORY REPORT OF ANALYSIS

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-001 1		LAYER 1 12"x12" Floor Tile, Beige/ Red/ Blue/ Gray	No		Carbonates Gypsum Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 2% Carbonates Quartz Binder/Filler 98%
0068736-002 2		LAYER 1 12"x12" Floor Tile, Beige/ Red/ Blue/ Gray	No		Carbonates Gypsum Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 1% Carbonates Quartz Binder/Filler 99%
0068736-003 3		LAYER 1 12"x12" Floor Tile, Beige/ Red/ Blue/ Gray	No		Carbonates Gypsum Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 2% Carbonates Quartz Binder/Filler 98%
0068736-004 4		LAYER 1 12"x12" Floor Tile, Lt. Brown/ Tan/ Beige	No		Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 2% Carbonates Quartz Binder/Filler 98%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-005 5		LAYER 1 12"x12" Floor Tile, Lt. Brown/ Tan/ Beige	No		Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 2% Carbonates Quartz Binder/Filler 98%
0068736-006 6		LAYER 1 12"x12" Floor Tile, Lt. Brown/ Tan/ Beige	No		Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber <1% Carbonates Quartz Binder/Filler 99%
0068736-007 7		LAYER 1 12"x12" Floor Tile, Gray/ Black	No		Carbonates Binder/Filler 100%
		LAYER 2 Mastic, Black	No		Cellulose Fiber <1% Carbonates Quartz Binder/Filler 99%
0068736-008 8		LAYER 1 12"x12" Floor Tile, Gray/ Black	No		Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Black	No		Cellulose Fiber <1% Carbonates Binder/Filler 99%
		LAYER 3 Concrete, Tan	No		Carbonates Quartz Gypsum Binder/Filler 100%

EMC LABS, INC.

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Laboratory Report

0068736

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-009		LAYER 1 12"x12" Floor Tile, Gray/ Black	No		Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Black	No		Carbonates Binder/Filler 100%
0068736-010		LAYER 1 12"x12" Floor Tile, Lt. Tan/ Beige	No		Carbonates Gypsum Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Carbonates Quartz Binder/Filler 100%
0068736-011		LAYER 1 12"x12" Floor Tile, Lt. Tan/ Beige	No		Carbonates Gypsum Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber <1% Carbonates Quartz Binder/Filler 99%
0068736-012		LAYER 1 12"x12" Floor Tile, Lt. Tan/ Beige	No		Carbonates Gypsum Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Carbonates Quartz Binder/Filler 100%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-013 13		Counter Top, Tan/ Lt. Gray/ Beige	No		Carbonates Quartz Binder/Filler 100%
0068736-014 14		Counter Top, Tan/ Lt. Gray/ Beige	No		Carbonates Quartz Binder/Filler 100%
0068736-015 15		Counter Top, Tan/ Lt. Gray/ Beige	No		Carbonates Quartz Binder/Filler 100%
0068736-016 16		2x2 Ceiling Tile, White/ Beige	No		Cellulose Fiber 40% Mineral Wool 40% Carbonates Perlite Binder/Filler 20%
0068736-017 17		2x2 Ceiling Tile, White/ Beige	No		Cellulose Fiber 40% Mineral Wool 40% Carbonates Perlite Binder/Filler 20%
0068736-018 18		2x2 Ceiling Tile, White/ Beige	No		Cellulose Fiber 40% Mineral Wool 40% Carbonates Perlite Binder/Filler 20%

EMC LABS, INC.

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Laboratory Report

0068736

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-019 19		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 8% Fibrous Glass 2% Gypsum Carbonates Mica Quartz 90%
		LAYER 2 Joint Compound/Texture, White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-020 20		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 8% Fibrous Glass 2% Gypsum Carbonates Mica Quartz 90%
		LAYER 2 Joint Compound/Texture, White	No		Carbonates Mica Quartz Binder/Filler 100%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-021 21		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Fibrous Glass 2% Gypsum Carbonates Mica Quartz 88%
		LAYER 2 Tape, White	No		Cellulose Fiber 98% Carbonates 2%
		LAYER 3 Joint Compound, White	No		Carbonates Mica Quartz 100%
		LAYER 4 Texture, White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-022 22		2x4 Ceiling Tile, White/ Beige	No		Cellulose Fiber 45% Mineral Wool 35% Carbonates Perlite Binder/Filler 20%
0068736-023 23		2x4 Ceiling Tile, White/ Beige	No		Cellulose Fiber 45% Mineral Wool 35% Carbonates Perlite Binder/Filler 20%
0068736-024 24		2x4 Ceiling Tile, White/ Beige	No		Cellulose Fiber 45% Mineral Wool 35% Carbonates Perlite Binder/Filler 20%
0068736-025 25		Ventilation Damper, Black	No		Fibrous Glass 40% Carbonates Quartz Binder/Filler 60%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-026 26		Ventilation Damper, Black	No		Fibrous Glass 40% Carbonates Quartz Binder/Filler 60%
0068736-027 27		Ventilation Damper, Black	No		Fibrous Glass 40% Carbonates Quartz Binder/Filler 60%
0068736-028 28		LAYER 1 2" Pipe Insulation, Yellow	No		Fibrous Glass 98% Carbonates 2%
		LAYER 2 2" Pipe Wrap Canvas Tape, Silver/ Brown	No		Cellulose Fiber 40% Fibrous Glass 10% Aluminum Carbonates Binder/Filler 50%
		LAYER 3 Mastic, White	No		Fibrous Glass 3% Carbonates Quartz Binder/Filler 97%
0068736-029 29		LAYER 1 2" Pipe Insulation, Yellow	No		Fibrous Glass 98% Carbonates 2%
		LAYER 2 2" Pipe Wrap Canvas Tape, Silver/ Brown	No		Cellulose Fiber 40% Fibrous Glass 10% Aluminum Carbonates Binder/Filler 50%
		LAYER 3 Mastic, White	No		Fibrous Glass 3% Cellulose Fiber 2% Carbonates Quartz Binder/Filler 95%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-030 30		LAYER 1 2" Pipe Insulation, Yellow	No		Fibrous Glass 98% Carbonates 2%
		LAYER 2 Mastic, White	No		Fibrous Glass 5% Carbonates Quartz Binder/Filler 95%
0068736-031 31		LAYER 1 6" Paper Wrap/ Canvas Wrap, Silver/ White	No		Cellulose Fiber 40% Fibrous Glass 10% Aluminum Carbonates Binder/Filler 50%
		LAYER 2 Mastic, White	No		Fibrous Glass 5% Cellulose Fiber 1% Carbonates Gypsum Quartz Binder/Filler 94%
0068736-032 32		LAYER 1 6" Pipe Insulation, Pink	No		Fibrous Glass 97% Cellulose Fiber 1% Carbonates 2%
		LAYER 2 Mastic, White	No		Fibrous Glass 3% Carbonates Quartz Binder/Filler 97%
0068736-033 33		LAYER 1 6" Paper Wrap/ Canvas Wrap, Silver/ White	No		Cellulose Fiber 40% Fibrous Glass 10% Aluminum Carbonates Binder/Filler 50%
		LAYER 2 Mastic, White	No		Fibrous Glass 5% Cellulose Fiber 1% Carbonates Gypsum Quartz Binder/Filler 94%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY	Date Received:	09/26/2008	
	McALLEN, TX 78501	Date Analyzed:	09/29/2008	
Collected:	09/24/2008	Date Reported:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION	EPA Method:	EPA 600/M4-82-020	
	BLDG			
Address:	100 E. CANO, EDINBURG, TX 78539	Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-034 34		Column Mud, White Note: Very small amount of Mud	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-035 35		Column Mud, White Note: Very small amount of Mud	No		Cellulose Fiber <1% Carbonates Mica Perlite Binder/Filler 99%
0068736-036 36		Column Mud, White Note: Very small amount of Mud	No		Cellulose Fiber 1% Carbonates Mica Binder/Filler 99%
0068736-037 37		LAYER 1 Wall Mud, White	No		Gypsum Carbonates Quartz Binder/Filler 100%
		LAYER 2 Wall Texture, Off White	Yes	Chrysotile 2%	Carbonates Mica Binder/Filler 98%
0068736-038 38		LAYER 1 Wall Mud, White	No		Gypsum Carbonates Quartz Binder/Filler 100%
		LAYER 2 Wall Texture, Off White	No		Carbonates Mica Quartz Binder/Filler 100%

EMC LABS, INC.

Laboratory Report
0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-039 39		LAYER 1 Wall Mud, White	No		Gypsum Carbonates Quartz Binder/Filler 100%
		LAYER 2 Wall Texture, Off White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-040 40		LAYER 1 12"x12" Floor Tile, Gray	No		Carbonates Gypsum Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow Note: Very small amount of sample	No		Carbonates Binder/Filler 100%
0068736-041 41		12"x12" Floor Tile, Gray	No		Carbonates Gypsum Quartz Binder/Filler 100%
0068736-042 42		12"x12" Floor Tile, Gray	No		Carbonates Gypsum Quartz Binder/Filler 100%
0068736-043 43		Sink Undercoating, Lt. Pink	Yes	Chrysotile 15%	Carbonates Quartz Binder/Filler 85%

EMC LABS, INC.

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Laboratory Report

0068736

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-044 44		Sink Undercoating, Lt. Pink	Yes	Chrysotile 15%	Carbonates Quartz Binder/Filler 85%
0068736-045 45		Sink Undercoating, Lt. Pink	Yes	Chrysotile 15%	Carbonates Quartz Binder/Filler 85%
0068736-046 46		4" Covebase Mastic, Beige/ Yellow	No		Cellulose Fiber <1% Carbonates Quartz Binder/Filler 99%
0068736-047 47		4" Covebase Mastic, Beige/ Yellow	No		Cellulose Fiber <1% Carbonates Quartz Binder/Filler 99%
0068736-048 48		4" Covebase Mastic, Beige/ Yellow	No		Carbonates Quartz Binder/Filler 100%
0068736-049 49		Spray-On Ceiling Texture, White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-050 50		Spray-On Ceiling Texture, White	No		Carbonates Mica Quartz Binder/Filler 100%

EMC LABS, INC.

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Laboratory Report
0068736

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-051 51		Spray-On Ceiling Texture, White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-052 52		LAYER 1 2" Elbow Canvas Tape Wrap, Clear	No		Fibrous Glass 95% Carbonates Binder/Filler 5%
		LAYER 2 Wrap Mastic, Off White	No		Synthetic Fiber 1% Carbonates Binder/Filler 99%
0068736-053 53		LAYER 1 2" Elbow Canvas Tape Wrap, Clear	No		Fibrous Glass 95% Carbonates Binder/Filler 5%
		LAYER 2 Wrap Mastic, Off White	No		Synthetic Fiber 3% Carbonates Binder/Filler 97%
0068736-054 54		LAYER 1 2" Elbow Canvas Tape Wrap, Clear	No		Fibrous Glass 95% Carbonates Binder/Filler 5%
		LAYER 2 Wrap Mastic, Off White	No		Synthetic Fiber 3% Carbonates Binder/Filler 97%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY	Date Received:	09/26/2008	
	McALLEN, TX 78501	Date Analyzed:	09/29/2008	
Collected:	09/24/2008	Date Reported:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION	EPA Method:	EPA 600/M4-82-020	
	BLDG			
Address:	100 E. CANO, EDINBURG, TX 78539	Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-055 55		LAYER 1 12"x12" Floor Tile, Pink	No		Carbonates Gypsum Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Carbonates Quartz Binder/Filler 100%
		LAYER 3 12"x12" Floor Tile, Off White	Yes	Chrysotile 3%	Non-Fibrous Tremolite 7%
		LAYER 4 Mastic, Black Note: Very small amount of mastic	Yes	Chrysotile 5%	Carbonates Quartz Binder/Filler 90%
0068736-056 56		LAYER 1 12"x12" Floor Tile, Pink	No		Carbonates Gypsum Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Carbonates Quartz Binder/Filler 100%
		LAYER 3 12"x12" Floor Tile, Off White	Yes	Chrysotile 3%	Non-Fibrous Tremolite 7%
		LAYER 4 Mastic, Black Note: Very small amount of mastic	Yes	Chrysotile 5%	Carbonates Quartz Binder/Filler 90%

EMC LABS, INC.

Laboratory Report
0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-057 57		LAYER 1 12"x12" Floor Tile, Pink	No		Carbonates Gypsum Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Carbonates Quartz Binder/Filler 100%
		LAYER 3 12"x12" Floor Tile, Off White	Yes	Chrysotile 3%	Non-Fibrous Tremolite 7% Carbonates Quartz Binder/Filler 90%
		LAYER 4 Mastic, Black Note: Very small amount of mastic	Yes	Chrysotile 3%	Carbonates Binder/Filler 97%
0068736-058 58		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Gypsum Carbonates Mica Quartz 90%
		LAYER 2 Joint Compound, Beige	Yes	Chrysotile 2%	Cellulose Fiber 1% Carbonates Mica Quartz Binder/Filler 97%
		LAYER 3 Texture, White/ Off White	No		Carbonates Mica Quartz Binder/Filler 100%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-059 59		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Gypsum Carbonates Mica Quartz 90%
		LAYER 2 Joint Compound, Beige	Yes	Chrysotile 2%	Cellulose Fiber 1% Carbonates Mica Quartz Binder/Filler 97%
		LAYER 3 Texture, White/ Off White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-060 60		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Gypsum Carbonates Mica Quartz 90%
		LAYER 2 Joint Compound, Beige	Yes	Chrysotile 2%	Cellulose Fiber 1% Carbonates Mica Quartz Binder/Filler 97%
		LAYER 3 Texture, White/ Off White	No		Carbonates Mica Quartz Binder/Filler 100%

EMC LABS, INC.

Laboratory Report
0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-061 61		LAYER 1 Wallboard, White/ Brown Note: No Joint Compound Present	No		Cellulose Fiber 10% Fibrous Glass 1% Gypsum Carbonates Mica Quartz 89%
		LAYER 2 Texture, Beige/ Off White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-062 62		LAYER 1 Wallboard, White/ Brown Note: No Joint Compound Present	No		Cellulose Fiber 10% Fibrous Glass 1% Gypsum Carbonates Mica Quartz 89%
		LAYER 2 Texture, Dk Blue/ Off White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-063 63		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Gypsum Carbonates Mica Quartz 90%
		LAYER 2 Joint Compound, Beige	Yes	Chrysotile 2%	Cellulose Fiber 1% Carbonates Mica Quartz Binder/Filler 97%
		LAYER 3 Texture, Lt Green/ Off White	No		Carbonates Mica Quartz Binder/Filler 100%

EMC LABS, INC.

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Laboratory Report

0068736

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-064 64		Mastic, Yellow/ Lt Yellow	No		Synthetic Fiber 1% Cellulose Fiber 1% Carbonates Gypsum Binder/Filler 98%
0068736-065 65		Mastic, Yellow/ Lt Yellow	No		Cellulose Fiber 2% Synthetic Fiber 1% Carbonates Gypsum Binder/Filler 97%
0068736-066 66		Mastic, Yellow/ Lt Yellow	No		Synthetic Fiber 1% Carbonates Gypsum Binder/Filler 99%
0068736-067 67		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Fibrous Glass 1% Gypsum Carbonates Mica 89%
		LAYER 2 Joint Compound, Off White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-068 68		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Fibrous Glass 1% Gypsum Carbonates Mica 89%
		LAYER 2 Joint Compound, Off White	No		Carbonates Mica Quartz Binder/Filler 100%

EMC LABS, INC.

Laboratory Report
0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client: RABA KISTNER Job# / P.O. #: ASF08-219-00 122882
Address: 800 E. HACKBERRY Date Received: 09/26/2008
McALLEN, TX 78501 Date Analyzed: 09/29/2008
Collected: 09/24/2008 Date Reported: 09/29/2008
Project Name/ HIDALGO COUNTY ADMINISTRATION EPA Method: EPA 600/M4-82-020
BLDG
Address: 100 E. CANO, EDINBURG, TX 78539 Submitted By: AL GURROLA
Collected By: Customer

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-069 69		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Fibrous Glass 1% Gypsum Carbonates Mica 89%
		LAYER 2 Joint Compound, Off White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-070 70		LAYER 1 4"- 6" Elbow Canvas Tape/ Paper Wrap, Beige/ White/ Silver Note: Difficult to separate adjacent layers	No		Cellulose Fiber 60% Fibrous Glass 20% Aluminum Gypsum Binder/Filler 20%
		LAYER 2 Wrap Mastic, Off White	No		Synthetic Fiber 10% Wollastonite 2% Carbonates Gypsum Binder/Filler 88%
0068736-071 71		LAYER 1 4"- 6" Elbow Canvas Tape/ Paper Wrap, Beige/ White/ Silver Note: Difficult to separate adjacent layers	No		Cellulose Fiber 60% Fibrous Glass 20% Aluminum Gypsum Binder/Filler 20%
		LAYER 2 Wrap Mastic, Off White	No		Synthetic Fiber 10% Wollastonite 2% Carbonates Gypsum Binder/Filler 88%

EMC LABS, INC.

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Laboratory Report
0068736

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-072 72		LAYER 1 4" - 6" Elbow Canvas Tape/ Paper Wrap, Beige/ White/ Silver Note: Difficult to separate adjacent layers	No		Cellulose Fiber 60% Fibrous Glass 20% Aluminum Gypsum Binder/Filler 20%
		LAYER 2 Wrap Mastic, Off White	No		Synthetic Fiber 10% Wollastonite 2% Carbonates Gypsum Binder/Filler 88%
0068736-073 73		LAYER 1 2" Tape Wrap, Beige/ Off White/ Silver Note: Difficult to separate adjacent layers	No		Cellulose Fiber 50% Fibrous Glass 20% Aluminum Gypsum Binder/Filler 30%
		LAYER 2 Wrap Mastic, Gray	Yes	Chrysotile 10%	Gypsum Carbonates Binder/Filler 90%
0068736-074 74		LAYER 1 2" Tape Wrap, Beige/ Off White/ Silver Note: Difficult to separate adjacent layers	No		Cellulose Fiber 50% Fibrous Glass 20% Aluminum Gypsum Binder/Filler 30%
		LAYER 2 Wrap Mastic, Gray	Yes	Chrysotile 10%	Gypsum Carbonates Binder/Filler 90%
0068736-075 75		LAYER 1 2" Tape Wrap, Clear Note: Difficult to separate adjacent layers	No		Fibrous Glass 95% Gypsum Binder/Filler 5%
		LAYER 2 Wrap Mastic, Gray	Yes	Chrysotile 10%	Fibrous Glass 2% Gypsum Carbonates Binder/Filler 88%

EMC LABS, INC.

Laboratory Report
0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-076 76		Sink Undercoating, White/ Off White	No		Cellulose Fiber 15% Carbonates Quartz Mica Gypsum Binder/Filler 85%
0068736-077 77		Sink Undercoating, White/ Off White	No		Cellulose Fiber 15% Carbonates Quartz Mica Gypsum Binder/Filler 85%
0068736-078 78		Sink Undercoating, White/ Off White	No		Cellulose Fiber 15% Carbonates Quartz Mica Gypsum Binder/Filler 85%
0068736-079 79		LAYER 1 12"x12" Floor Tile, Blue	No		Carbonates Gypsum Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 3% Carbonates Gypsum Binder/Filler 97%
0068736-080 80		LAYER 1 12"x12" Floor Tile, Blue	No		Carbonates Gypsum Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow Note: Very small amount of mastic	No		Carbonates Gypsum Quartz Binder/Filler 100%

EMC LABS, INC.

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
 Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Laboratory Report
0068736

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY	Date Received:	09/26/2008	
	McALLEN, TX 78501	Date Analyzed:	09/29/2008	
Collected:	09/24/2008	Date Reported:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION	EPA Method:	EPA 600/M4-82-020	
	BLDG			
Address:	100 E. CANO, EDINBURG, TX 78539	Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-081 81		LAYER 1 12"x12" Floor Tile, Blue	No		Carbonates Gypsum Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 3% Carbonates Gypsum Binder/Filler 97%
0068736-082 82		2'x2' CT - Rough Surface, White/ Gray	No		Mineral Wool 90% Gypsum Binder/Filler 10%
0068736-083 83		2'x2' CT - Rough Surface, Gray/ Beige/ Silver	No		Mineral Wool 70% Cellulose Fiber 10% Aluminum Carbonates Gypsum Binder/Filler 20%
0068736-084 84		2'x2' CT - Rough Surface, Gray/ Beige/ Silver	No		Mineral Wool 70% Cellulose Fiber 10% Aluminum Carbonates Gypsum Binder/Filler 20%
0068736-085 85		LAYER 1 2" Canvas Tape Wrap, Beige/ Off White/ Silver Note: Difficult to separate adjacent layers	No		Cellulose Fiber 50% Fibrous Glass 20% Aluminum Gypsum Binder/Filler 30%
		LAYER 2 Wrap Mastic, Off White	No		Cellulose Fiber 5% Carbonates Gypsum Binder/Filler 95%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-086 86		LAYER 1 2" Canvas Tape Wrap, Beige/ Off White/ Silver Note: Difficult to separate adjacent layers	No		Cellulose Fiber 50% Fibrous Glass 20% Aluminum Gypsum Binder/Filler 30%
		LAYER 2 Wrap Mastic, Off White	No		Cellulose Fiber 5% Carbonates Gypsum Binder/Filler 95%
0068736-087 87		LAYER 1 2" Elbow Canvas Tape Wrap, Clear	No		Fibrous Glass 95% Carbonates Gypsum Binder/Filler 5%
		LAYER 2 Wrap Mastic, Off White	No		Fibrous Glass 3% Gypsum Quartz Carbonates Binder/Filler 97%
0068736-088 88		LAYER 1 Mastic, Black	Yes	Chrysotile 10%	Fibrous Glass 3% Carbonates Quartz Binder/Filler 87%
		LAYER 2 Wrap, Silver/ Black/ Brown	No		Cellulose Fiber 60% Gypsum Binder/Filler 40%
0068736-089 89		LAYER 1 Mastic, Black	Yes	Chrysotile 10%	Fibrous Glass 3% Carbonates Quartz Binder/Filler 87%
		LAYER 2 Wrap, Silver/ Black/ Brown	No		Cellulose Fiber 60% Gypsum Binder/Filler 40%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client: RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address: 800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected: 09/24/2008	Date Analyzed:	09/29/2008	
Project Name/ HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address: 100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
	Submitted By:	AL GURROLA	
	Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-090 90		LAYER 1 Mastic, Black	Yes	Chrysotile 10%	Fibrous Glass 2% Carbonates Quartz Binder/Filler 88%
		LAYER 2 Wrap, Silver/ Black/ Brown	No		Cellulose Fiber 60% Gypsum Binder/Filler 40%
0068736-091 91		LAYER 1 Concrete, Tan	No		Gypsum Perlite Quartz Binder/Filler 100%
		LAYER 2 Mud, White	No		Gypsum Mica Carbonates Binder/Filler 100%
0068736-092 92		LAYER 1 Concrete, Tan	No		Gypsum Perlite Quartz Binder/Filler 100%
		LAYER 2 Mud, White	No		Gypsum Mica Carbonates Binder/Filler 100%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-093 93		LAYER 1 Concrete, Tan	No		Gypsum Perlite Quartz Binder/Filler 100%
		LAYER 2 Mud, White	No		Gypsum Mica Carbonates Binder/Filler 100%
0068736-094 94		LAYER 1 Wallboard, White/ Brown Note: No Joint Compound Present	No		Cellulose Fiber 10% Fibrous Glass 1% Gypsum Carbonates Mica 89%
		LAYER 2 Texture, Beige/ Off White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-095 95		Wallboard, White/ Brown Note: No Joint Compound & Texture Present	No		Cellulose Fiber 10% Gypsum Carbonates Mica Binder/Filler 90%
0068736-096 96		LAYER 1 Wallboard, White/ Brown Note: No Joint Compound Present	No		Cellulose Fiber 10% Fibrous Glass 1% Gypsum Carbonates Mica 89%
		LAYER 2 Texture, Beige/ Off White	No		Carbonates Mica Quartz Binder/Filler 100%

EMC LABS, INC.

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Laboratory Report

0068736

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-097 97		4" Cove Base Mastic, Dk Brown/ Tan	No		Cellulose Fiber 1% Gypsum Quartz Carbonates Binder/Filler 99%
0068736-098 98		4" Cove Base Mastic, Dk Brown/ Tan	No		Cellulose Fiber <1% Carbonates Gypsum Binder/Filler 99%
0068736-099 99		4" Cove Base Mastic, Dk Brown/ Tan	No		Cellulose Fiber <1% Carbonates Gypsum Binder/Filler 99%
0068736-100 100		LAYER 1 12"x12" Floor Tile, Brown	No		Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 5% Carbonates Gypsum Binder/Filler 95%
		LAYER 3 Mastic, Black	Yes	Chrysotile 5%	Cellulose Fiber 2% Carbonates Gypsum Binder/Filler 93%

EMC LABS, INC.

Laboratory Report
0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-101 101		LAYER 1 12"x12" Floor Tile, Brown	No		Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 5% Carbonates Gypsum Binder/Filler 95%
		LAYER 3 Mastic, Black	Yes	Chrysotile 8%	Cellulose Fiber 2% Carbonates Gypsum Binder/Filler 90%
0068736-102 102		LAYER 1 12"x12" Floor Tile, Brown	No		Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 5% Carbonates Gypsum Binder/Filler 95%
		LAYER 3 Mastic, Black	Yes	Chrysotile 8%	Cellulose Fiber 2% Carbonates Gypsum Binder/Filler 90%
0068736-103 103		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Gypsum Carbonates Mica 90%
		LAYER 2 Joint Compound, Beige	Yes	Chrysotile 2%	Cellulose Fiber 1% Carbonates Mica Quartz 97%
		LAYER 3 Texture, Beige/ Off White	No		Carbonates Mica Binder/Filler 100%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-104 104		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Gypsum Carbonates Mica 90%
		LAYER 2 Joint Compound, Beige	Yes	Chrysotile 3%	Carbonates Mica Quartz 97%
		LAYER 3 Texture, Beige/ Off White	No		Carbonates Mica Binder/Filler 100%
0068736-105 105		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Gypsum Carbonates Mica 90%
		LAYER 2 Joint Compound, Beige	Yes	Chrysotile 3%	Carbonates Mica Quartz 97%
		LAYER 3 Texture, Beige/ Off White	No		Carbonates Mica Binder/Filler 100%

EMC LABS, INC.

Laboratory Report
0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)		Non-Asbestos Constituents
0068736-106 106		LAYER 1 12"x12" Floor Tile, Beige	No			Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No			Cellulose Fiber 2% Gypsum Carbonates Quartz Binder/Filler 98%
		LAYER 3 12"x12" Floor Tile, Off White	Yes	Chrysotile Tremolite	3% 2%	Non-Fibrous Tremolite 5% Gypsum Carbonates Quartz Binder/Filler 90%
		LAYER 4 Mastic, Black	Yes	Chrysotile	12%	Gypsum Carbonates Binder/Filler 88%
0068736-107 107		LAYER 1 12"x12" Floor Tile, Beige	No			Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No			Cellulose Fiber 2% Gypsum Carbonates Quartz Binder/Filler 98%
		LAYER 3 12"x12" Floor Tile, Off White	Yes	Chrysotile Tremolite	3% 2%	Non-Fibrous Tremolite 5% Gypsum Carbonates Quartz Binder/Filler 90%
		LAYER 4 Mastic, Black	Yes	Chrysotile	10%	Gypsum Carbonates Binder/Filler 90%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client: RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address: 800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected: 09/24/2008	Date Analyzed:	09/29/2008	
Project Name/ HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address: 100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
	Submitted By:	AL GURROLA	
	Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-108 108		LAYER 1 12"x12" Floor Tile, Beige	No		Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 2% Gypsum Carbonates Quartz Binder/Filler 98%
		LAYER 3 12"x12" Floor Tile, Off White	Yes	Chrysotile 3% Tremolite 2%	Non-Fibrous Tremolite 5% Gypsum Carbonates Quartz Binder/Filler 90%
		LAYER 4 Mastic, Black	Yes	Chrysotile 12%	Gypsum Carbonates Binder/Filler 88%
0068736-109 109		Cove Base Mastic, Black/ Brown/ Tan	No		Wollastonite 5% Carbonates Gypsum Binder/Filler 95%
0068736-110 110		Cove Base Mastic, Black/ Brown/ Tan	No		Cellulose Fiber <1% Gypsum Carbonates Binder/Filler 99%
0068736-111 111		Cove Base Mastic, Black/ Brown/ Tan	No		Wollastonite 5% Carbonates Gypsum Binder/Filler 95%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-112 112		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Gypsum Carbonates Mica 90%
		LAYER 2 Joint Compound, White	No		Cellulose Fiber 1% Carbonates Mica 99%
		LAYER 3 Texture, White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-113 113		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Gypsum Carbonates Mica 90%
		LAYER 2 Joint Compound, White	No		Cellulose Fiber 1% Carbonates Mica 99%
		LAYER 3 Texture, White	No		Carbonates Mica Quartz Binder/Filler 100%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-114 114		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Gypsum Carbonates Mica 90%
		LAYER 2 Joint Compound/ Paint, White Note: Sample is mainly Paint - little Compound present	No		Cellulose Fiber 1% Carbonates Mica 99%
		LAYER 3 Texture / Paint, White Note: Sample is mainly Paint - little Texture present	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-115 115		LAYER 1 12"x12" Floor Tile, White	No		Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 3% Carbonates Gypsum Binder/Filler 97%
0068736-116 116		LAYER 1 12"x12" Floor Tile, White	No		Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 1% Carbonates Gypsum Binder/Filler 99%

EMC LABS, INC.

Laboratory Report
0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-117 117		LAYER 1 12"x12" Floor Tile, White	No		Carbonates Quartz Binder/Filler 100%
		LAYER 2 Mastic, Yellow	No		Cellulose Fiber 3% Carbonates Gypsum Binder/Filler 97%
0068736-118 118		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Fibrous Glass 2% Gypsum Mica Carbonates 88%
		LAYER 2 Joint Compound, White	No		Carbonates Mica 100%
		LAYER 3 Texture, White	No		Carbonates Mica Binder/Filler 100%
0068736-119 119		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Fibrous Glass 2% Gypsum Mica Carbonates 88%
		LAYER 2 Joint Compound, White	No		Carbonates Mica 100%
		LAYER 3 Texture, White	No		Carbonates Mica Binder/Filler 100%

EMC LABS, INC.

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Laboratory Report
0068736

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-120 120		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Fibrous Glass 2% Gypsum Mica Carbonates 88%
		LAYER 2 Joint Compound, White	No		Cellulose Fiber 1% Carbonates Mica 99%
		LAYER 3 Texture, White	No		Carbonates Mica Binder/Filler 100%
0068736-121 121		LAYER 1 8" Paper Wrap, Silver/ White	No		Fibrous Glass 20% Cellulose Fiber 10% Aluminum Gypsum Binder/Filler 70%
		LAYER 2 Tape Canvas, Off White	No		Cellulose Fiber 90% Gypsum Binder/Filler 10%
		LAYER 3 Mastic, Off White	No		Fibrous Glass 5% Gypsum Quartz Binder/Filler 95%
0068736-122 122		LAYER 1 8" Paper Wrap, Silver/ White	No		Fibrous Glass 20% Cellulose Fiber 10% Aluminum Gypsum Binder/Filler 70%
		LAYER 2 Tape Canvas, Off White	No		Cellulose Fiber 90% Gypsum Binder/Filler 10%
		LAYER 3 Mastic, Off White	No		Fibrous Glass 5% Gypsum Quartz Binder/Filler 95%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-123 123		LAYER 1 8" Paper Wrap, White	No		Fibrous Glass 20% Gypsum Binder/Filler 80%
		LAYER 2 Tape Canvas, Off White	No		Fibrous Glass 50% Carbonates Gypsum Binder/Filler 50%
		LAYER 3 Mastic, Off White	No		Gypsum Quartz Binder/Filler 100%
0068736-124 124		LAYER 1 4"-8" Paper Wrap, White/ Silver	No		Fibrous Glass 20% Cellulose Fiber 10% Aluminum Gypsum Binder/Filler 70%
		LAYER 2 Tape Canvas, White	No		Cellulose Fiber 80% Gypsum Binder/Filler 20%
		LAYER 3 Mastic, Off White	No		Cellulose Fiber 3% Gypsum Binder/Filler 97%
0068736-125 125		LAYER 1 4"-8" Paper Wrap, White/ Silver	No		Fibrous Glass 20% Cellulose Fiber 10% Aluminum Gypsum Binder/Filler 70%
		LAYER 2 Tape Canvas, White	No		Cellulose Fiber 80% Gypsum Binder/Filler 20%
		LAYER 3 Mastic, Off White	No		Cellulose Fiber 3% Gypsum Binder/Filler 97%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
 Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY	Date Received:	09/26/2008	
	McALLEN, TX 78501	Date Analyzed:	09/29/2008	
Collected:	09/24/2008	Date Reported:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION	EPA Method:	EPA 600/M4-82-020	
	BLDG			
Address:	100 E. CANO, EDINBURG, TX 78539	Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-126 126		LAYER 1 4"-8" Paper Wrap, White/ Silver	No		Fibrous Glass 20% Cellulose Fiber 10% Aluminum Gypsum Binder/Filler 70%
		LAYER 2 Tape Canvas, White	No		Cellulose Fiber 80% Gypsum Binder/Filler 20%
		LAYER 3 Mastic, Off White	No		Cellulose Fiber 3% Gypsum Binder/Filler 97%
0068736-127 127		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Fibrous Glass 2% Gypsum Carbonates Mica 88%
		LAYER 2 Joint Compound, White	No		Carbonates Mica Quartz 100%
		LAYER 3 Texture, White	No		Carbonates Mica Quartz Binder/Filler 100%

EMC LABS, INC.

Laboratory Report

0068736

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID Client ID	Sample Location	Layer Name / Sample Description	Asbestos Detected	Asbestos Type (%)	Non-Asbestos Constituents
0068736-128 128		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Fibrous Glass 2% Gypsum Carbonates Mica 88%
		LAYER 2 Joint Compound, White	No		Carbonates Mica Quartz 100%
		LAYER 3 Texture, White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-129 129		LAYER 1 Wallboard, White/ Brown	No		Cellulose Fiber 10% Fibrous Glass 2% Gypsum Carbonates Mica 88%
		LAYER 2 Joint Compound, White	No		Carbonates Mica Quartz 100%
		LAYER 3 Texture, White	No		Carbonates Mica Quartz Binder/Filler 100%
0068736-130 130		Cloth Canvas Wrap, Old Yellow	No		Cellulose Fiber 90% Gypsum Binder/Filler 10%
0068736-131 131		Cloth Canvas Wrap, Old Yellow	No		Cellulose Fiber 90% Gypsum Binder/Filler 10%

EMC LABS, INC.

9830 S. 51st Street, Suite B109, Phoenix, AZ 85044
Phone: 800-362-3373 or 480-940-5294 - Fax: (480) 893-1726

Laboratory Report
0068736

Bulk Asbestos Analysis by Polarized Light Microscopy

NVLAP#101926-0

Client:	RABA KISTNER	Job# / P.O. #:	ASF08-219-00	122882
Address:	800 E. HACKBERRY McALLEN, TX 78501	Date Received:	09/26/2008	
Collected:	09/24/2008	Date Analyzed:	09/29/2008	
Project Name/	HIDALGO COUNTY ADMINISTRATION BLDG	Date Reported:	09/29/2008	
Address:	100 E. CANO, EDINBURG, TX 78539	EPA Method:	EPA 600/M4-82-020	
		Submitted By:	AL GURROLA	
		Collected By:	Customer	

Lab ID	Sample	Layer Name /	Asbestos	Asbestos Type	Non-Asbestos
Client ID	Location	Sample Description	Detected	(%)	Constituents
0068736-132		Cloth Canvas Wrap, Old Yellow	No		Cellulose Fiber 90%
132					Gypsum Binder/Filler 10%



Analyst - Kenneth Scheske



Signatory - Lab Director - Kurt Kettler

Distinctly stratified, easily separable layers of samples are analyzed as subsamples of the whole and are reported separately for each discernible layer. All analyses are derived from calibrated visual estimate and measured in weight percent unless otherwise noted. The report applies to the standards or procedures identified and to the sample(s) tested. The test results are not necessarily indicative or representative of the qualities of the lot from which the sample was taken or of apparently identical or similar products, nor do they represent an ongoing quality assurance program unless so noted. These reports are for the exclusive use of the addressed client and that they will not be reproduced wholly or in part for advertising or other purposes over our signature or in connection with our name without special written permission. The report shall not be reproduced except in full, without written approval by our laboratory. The samples not destroyed in testing are retained a maximum of thirty days. The laboratory measurement of uncertainty for the test method is approximately <1% by weight. Accredited by the National Institute of Standards and Technology, Voluntary Laboratory Accreditation Program for selected test method for asbestos. The accreditation or any reports generated by this laboratory in no way constitutes or implies product certification, approval, or endorsement by the National Institute of Standards and Technology. The report must not be used by any entity to claim product endorsement by NVLAP or any agency of the U.S. Government. Polarized Light Microscopy may not be consistently reliable in detecting asbestos in floor coverings and similar non-fragile organically bound materials.



CHAIN OF CUSTODY
 EMC Laboratories
 9830 S. 51ST St., Ste B-109
 Phoenix, AZ 85044
 (800) 362-3373 Fax (480) 893-1726

LAB#: 68736
 TAT: 1 day
 Rec'd: SEP 26 AM
 EMC USE ONLY

COMPANY NAME: RABA KISTNER
800 E. Hackberry
McAllen, TX 78501
 CONTACT: Al Gurrola
 Phone/Fax: (956) 682-5332 / (956) 682-5487
 Email: agurrola@rkci.com

BILL TO: _____ (If Different Location)

E-MAILED SEP 29 2008

Now Accepting: **VISA - MASTERCARD** Price Quoted: \$ _____ / Sample \$ _____ / Layers

COMPLETE ITEMS 1-4: (Failure to complete any items may cause a delay in processing or analyzing your samples)

1. **TURNAROUND TIME:** [4hr rush] [8hr rush] 1-Day [2-Day] [3-Day] [5-Day] [6-10 Day]

***Prior confirmation of turnaround time is required
 ***Additional charges for rush analysis (please call marketing department for pricing details)
 ***Laboratory analysis may be subject to delay if credit terms are not met

2. **TYPE OF ANALYSIS:** Bulk-PCM [Air-PCM] [Lead] [Point Count] [Fungi: AOC, W-C, Bulk, Swab, Tape]

3. **DISPOSAL INSTRUCTIONS:** [Dispose of samples at EMC] / [Return samples to me at my expense]
 (If you do not indicate preference, EMC will dispose of samples 60 days from analysis.)

13

4. Project Name: Hidalgo County Administration Bldg - 100 E Camp, Edinburg, TX 78539
 P.O. Number: 122882 Project Number: ASF08-219-00

EMC SAMPLE #	CLIENT SAMPLE #	DATE & TIME SAMPLED	LOCATION/MATERIAL TYPE	Samples Accepted Yes / No	AIR SAMPLE INFO / COMMENTS		
					ON	OFF	FLOW RATE
1	1	9-24-08	12"x12" FT w Yellow Mastic	(Reject)			
2	2	[Large handwritten mark]	" "	Y N			
3	3		" "	Y N			
4	4		12"x12" FT + Yellow Mastic	(at Brk)			
5	5		" "	N			
6	6		" "	N			
7	7		12"x12" FT + Black Mastic	(at Brk)			
8	8		" "	Y N			
9	9		" "	Y N			
10	10		12"x12" FT + Yellow Mastic	(at Brk)			
11	11		" "	Y N			
12	12		" "	Y N			
13	13		Counter Tops - tan	Y N			
14	14		" "	Y N			
15	15		" "	Y N			

SPECIAL INSTRUCTIONS: _____
 Sample Collector: (Print) AL (Signature) [Signature]
 Relinquished by: [Signature] Date/Time: 9-25-08 Received by: [Signature] Date/Time: 9/26/08
 Relinquished by: [Signature] Date/Time: 9/26/08 Received by: [Signature] Date/Time: 9/29/08
 Relinquished by: _____ Date/Time: _____ Received by: _____ Date/Time: _____

*** In the event of any dispute between the above parties for these services or otherwise, parties agree that jurisdiction and venue will be in Phoenix, Arizona and prevailing party will be entitled to attorney's fees and court costs.

CHAIN OF CUSTODY
 EMC Laboratories
 9830 S. 51ST St., Ste B-109
 Phoenix, AZ 85044
 (800) 362-3373 Fax (480) 893-1726

LAB#: _____
 TAT: 69736
 Rec'd: _____
 EMC USE ONLY

COMPANY NAME: RABA KISTNER
800 E. Hackberry
McAllen, TX 78501
 CONTACT: Al Gurrola
 Phone/Fax: (958) 682-5332 / (956) 682-5487
 Email: agurrola@rkci.com

BILL TO: _____ (If Different Location)

Now Accepting: VISA - MASTERCARD Price Quoted: \$ _____ / Sample \$ _____ / Layers

COMPLETE ITEMS 1-4: (Failure to complete any items may cause a delay in processing or analyzing your samples)

1. **TURNAROUND TIME:** [4hr rush] [8hr rush] (1-Day) [2-Day] [3-Day] [5-Day] [6-10 Day]

--- Prior confirmation of turnaround time is required

*** Additional charges for rush analysis (please call marketing department for pricing details)

**** Laboratory analysis may be subject to delay if credit terms are not met

2. **TYPE OF ANALYSIS:** [Bulk-PLM] [Air-PCM] [Lead] [Point Count] [Fungi: AOC, W-C, Bulk, Swab, Tape]

3. **DISPOSAL INSTRUCTIONS:** [Dispose of samples at EMC] / [Return samples to me at my expense]
 (If you do not indicate preference, EMC will dispose of samples 60 days from analysis.)

4. Project Name: Old Hidalgo County Administration Bldg - 100 E. Cano Blvd, Edinburg TX 78539
 P.O. Number: 122882 Project Number: ASF08-219-00

EMC SAMPLE #	CLIENT SAMPLE #	DATE & TIME SAMPLED	LOCATION/MATERIAL TYPE	Samples Accepted Yes / No	AIR SAMPLE INFO / COMMENTS		
					ON	OFF	FLOW RATE
16	16	9-24-08	2'x2' Ceiling Tile - white/beige	Y N			
17	17	↓	" " "	Y N			
18	18		" " "	Y N			
19	19		Wallboard, Joint Compound/Texture	Y N			
20	20		" " "	Y N			
21	21		" " "	Y N			
22	22		2'x4' Ceiling Tile - w/beige	Y N			
23	23		" " "	Y N			
24	24		" " "	Y N			
25	29		Ventilation Damper - Black	Y N			
26	26		" " "	Y N			
27	27	" " "	Y N				
28	28	2" P-wrap Canvas Tape + Mastic	Y N				
29	29	" " "	Y N				
30	30	" " "	Y N				

SPECIAL INSTRUCTIONS:

Sample Collector: (Print) _____ (Signature) [Signature]
 Relinquished by: [Signature] Date/Time: 9-25-08 Received by: Diana Federico Date/Time: 9/26/08
 Relinquished by: Diana Federico Date/Time: 9/26/08 Received by: [Signature] Date/Time: 9-29-08
 Relinquished by: _____ Date/Time: _____ Received by: _____ Date/Time: _____

** In the event of any dispute between the above parties for these services or otherwise, parties agree that jurisdiction and venue will be in Phoenix, Arizona and prevailing party will be entitled to attorney's fees and court costs.

CHAIN OF CUSTODY

EMC Laboratories
 9830 S. 51ST St., Ste B-109
 Phoenix, AZ 85044
 (800) 362-3373 Fax (480) 893-1726

LAB#: _____
 TAT: 68736
 Rec'd:
 EMC USE ONLY

COMPANY NAME: RABA KISTNER
800 E. Hackberry
McAllen, TX 78501
 CONTACT: Al Gurrola
 Phone/Fax: (956) 682-5332 / (956) 682-5487
 Email: agurrola@rkci.com

BILL TO: _____ (If Different Location)

Now Accepting: VISA - MASTERCARD Price Quoted: \$ _____ / Sample \$ _____ / Layers

COMPLETE ITEMS 1-4: (Failure to complete any items may cause a delay in processing or analyzing your samples)

1. TURNAROUND TIME: [4hr rush] [8hr rush] [1-Day] [2-Day] [3-Day] [5-Day] [6-10 Day]

***Prior confirmation of turnaround time is required

***Additional charges for rush analysis (please call marketing department for pricing details)

***Laboratory analysis may be subject to delay if credit terms are not met

2. TYPE OF ANALYSIS: [Bulk-PCM] [Air-PCM] [Lead] [Point Count] [Fungi: AOC, W-C, Bulk, Swab, Tape]

3. DISPOSAL INSTRUCTIONS: [Dispose of samples at EMC] / [Return samples to me at my expense]
 (If you do not indicate preference, EMC will dispose of samples 60 days from analysis.)

4. Project Name: Old Hidalgo County Administration bldg - 100 E. Cano, Edinburg, TX 78539
 P.O. Number: 122882 Project Number: ASF08-219-00

EMC SAMPLE #	CLIENT SAMPLE #	DATE & TIME SAMPLED	LOCATION/MATERIAL TYPE	Samples Accepted Yes / No	AIR SAMPLE INFO / COMMENTS		
					ON	OFF	FLOW RATE
31	31	9-24-8	6" Paper Wrap, Mastik + Canvas wrap	N			
32	32		" " "	Y N			
33	33		" " "	Y N			
34	34		Mud (white) - Round Columns	Y N			
35	35		" " "	Y N			
36	36		" " "	Y N			
37	37		Wall Mud - Concrete wall Vault	Y N			
38	38		" " "	Y N			
39	39		" " "	Y N			
40	40		12" x 12" FT + Yellow Mastik (Gray)	Y N			
41	41		" " "	Y N			
42	42		" " "	Y N			
43	43		Sink Under coat - Lt. pink	Y N			
44	44		" " "	Y N			
45	45		" " "	Y N			

SPECIAL INSTRUCTIONS:

Sample Collector: (Prim) ALG. (Signature) [Signature]
 Relinquished by: [Signature] Date/Time: 9-25-8 Received by: Diana Federico Date/Time: 9/26/08
 Relinquished by: Diana Federico Date/Time: 9/24/08 Received by: [Signature] Date/Time: 9/29/08
 Relinquished by: _____ Date/Time: _____ Received by: _____ Date/Time: _____

** In the event of any dispute between the above parties for these services or otherwise, parties agree that jurisdiction and venue will be in Phoenix, Arizona and prevailing party will be entitled to attorney's fees and court costs.

CHAIN OF CUSTODY

EMC Laboratories
 9830 S. 51ST St., Ste B-109
 Phoenix, AZ 85044
 (800) 362-3373 Fax (480) 893-1726

LAB#: _____
 TAT: 68736
 Rec'd: _____
 EMC USE ONLY

COMPANY NAME: RABA KISTNER
800 E. Hackberry
McAllen, TX 78501
 CONTACT: Al Gurrola
 Phone/Fax: (956) 682-5332 / (956) 682-5487
 Email: agurrola@rkci.com

BILL TO: _____ (If Different Location)

Now Accepting: **VISA - MASTERCARD** Price Quoted: \$ _____ / Sample \$ _____ / Layers

COMPLETE ITEMS 1-4: (Failure to complete any items may cause a delay in processing or analyzing your samples)

1. **TURNAROUND TIME:** [4hr rush] [8hr rush] [~~1-Day~~] [2-Day] [3-Day] [5-Day] [6-10 Day]

***Prior confirmation of turnaround time is required
 ***Additional charges for rush analysis (please call marketing department for pricing details)
 ***Laboratory analysis may be subject to delay if credit terms are not met

2. **TYPE OF ANALYSIS:** [Bulk-PLM] [Air-PCM] [Lead] [Point Count] [Fungi: AOC, W-C, Bulk, Swab, Tape]

3. **DISPOSAL INSTRUCTIONS:** [Dispose of samples at EMC] / [Return samples to me at my expense]
 (If you do not indicate preference, EMC will dispose of samples 60 days from analysis.)

4. **Project Name:** Old Hidalgo County Administration Bldg. 100 E. Cano, Edinburg, TX 78539
P.O. Number: 122882 **Project Number:** ASF08-219-00

EMC SAMPLE #	CLIENT SAMPLE #	DATE & TIME SAMPLED	LOCATION/MATERIAL TYPE	Samples Accepted Yes / No	AIR SAMPLE INFO / COMMENTS		
					ON	OFF	FLOW RATE
46	46	9-24-8	4" Cove base Mastic beige/yellow	Y N			
47	47		" " "	Y N			
48	48		" " "	Y N			
49	49		Spray-On Ceiling Texture	Y N			
50	50		" " "	Y N			
51	51		" " "	Y N			
52	52		2" Elbow Wrap/Mastic(w) + Canvas Tape	Y N			
53	53		" " "	Y N			
54	54		" " "	Y N			
55	55		12"x12" FT (pink) + Yellow Mastic	Y N			
56	56		" " "	Y N			
57	57		" " "	Y N			
58	58		WAMboard, IC + Texture	Y N			
59	59		" " "	Y N			
60	60		" " "	Y N			

SPECIAL INSTRUCTIONS: _____
 Sample Collector: (Print) AL G. (Signature) [Signature]
 Relinquished by: [Signature] Date/Time: 9-25-8 Received by: Diana Federico Date/Time: 9/26/08
 Relinquished by: Diana Federico Date/Time: 9/26/08 Received by: [Signature] Date/Time: 9-29-08
 Relinquished by: _____ Date/Time: _____ Received by: _____ Date/Time: _____

*** In the event of any dispute between the above parties for these services or otherwise, parties agree that jurisdiction and venue will be in Phoenix, Arizona and prevailing party will be entitled to attorney's fees and court costs.

CHAIN OF CUSTODY
 EMC Laboratories
 9830 S. 51ST St., Ste B-109
 Phoenix, AZ 85044
 (800) 362-3373 Fax (480) 893-1726

LAB#: _____
 TAT: 68734
 Rec'd:
 EMC USE ONLY

COMPANY NAME: RABA KISTNER
800 E. Hackberry
McAllen, TX 78501
 CONTACT: Al Gurrola
 Phone/Fax: (956) 682-5332 / (956) 682-5487
 Email: agurrola@rkl.com

BILL TO: _____ (If Different Location)

Now Accepting: VISA - MASTERCARD Price Quoted: \$ _____ / Sample \$ _____ / Layers

COMPLETE ITEMS 1-4: (Failure to complete any items may cause a delay in processing or analyzing your samples)

1. **TURNAROUND TIME:** [4hr rush] [8hr rush] [1-Day] [2-Day] [3-Day] [5-Day] [6-10 Day]

***Prior confirmation of turnaround time is required
 ***Additional charges for rush analysis (please call marketing department for pricing details)
 ***Laboratory analysis may be subject to delay if credit terms are not met

2. **TYPE OF ANALYSIS:** [Bulk-PLM] [Air-PCM] [Lead] [Point Count] [Fungi: AOC, W-C, Bulk, Swab, Tape]

3. **DISPOSAL INSTRUCTIONS:** [Dispose of samples at EMC] / [Return samples to me at my expense]
 (If you do not indicate preference, EMC will dispose of samples 60 days from analysis.)

4. Project Name: Old Hidalgo County Administration Bldg. - 100E Cano, Edinburg TX 78589

P.O. Number: 122882 Project Number: ASF08-219-00

EMC SAMPLE #	CLIENT SAMPLE #	DATE & TIME SAMPLED	LOCATION/MATERIAL TYPE	Samples Accepted Yes / No	AIR SAMPLE INFO / COMMENTS		
					ON	OFF	FLOW RATE
61	61	9-24-8	Wallboard, J.C./Texture	(500th) Y N			
62	62	↓	" " "	Y N			
63	63		" " "	Y N			
64	64	9-25-8	Yellow/lt Yellow Mastie	Y N			
65	65	↓	" " "	Y N			
66	66		" " "	Y N			
67	67		Wall Board, J.C./Texture	Y N			
68	68		" " "	Y N			
69	69		" " "	Y N			
70	70		4" x 6" JT Comas Tape, Mastie + Paper Wrap	Y N			
71	71		" " "	Y N			
72	72		" " "	Y N			
73	73		2" Wrap + Gray Mastie	Y N			
74	74		" " "	Y N			
75	75	" " "	Y N				

SPECIAL INSTRUCTIONS:

Sample Collector: (Print) Al G. (Signature) [Signature]
 Relinquished by: [Signature] Date/Time: 9-25-8 Received by: Diana Federico Date/Time: 9/26/08
 Relinquished by: Diana Federico Date/Time: 9/26/08 Received by: _____ Date/Time: 9/29/08
 Relinquished by: _____ Date/Time: _____ Received by: _____ Date/Time: _____

** In the event of any dispute between the above parties for these services or otherwise, parties agree that jurisdiction and venue will be in Phoenix, Arizona and prevailing party will be entitled to attorney's fees and court costs.

CHAIN OF CUSTODY

EMC Laboratories
 9830 S. 51ST St., Ste B-109
 Phoenix, AZ 85044
 (800) 362-3373 Fax (480) 893-1726

LAB#:
TAT: <u>68734</u>
Rec'd: EMC USE ONLY

COMPANY NAME: RABA KISTNER
800 E. Hackberry
McAllen, TX 78501

CONTACT: Al Gurrola
 Phone/Fax: (956) 682-5332 / (956) 682-5487
 Email: agurrola@rkci.com

BILL TO: _____ (If Different Location)

Now Accepting: **VISA - MASTERCARD** Price Quoted: \$_____/Sample \$_____/Layers

COMPLETE ITEMS 1-4: (Failure to complete any items may cause a delay in processing or analyzing your samples)

1. **TURNAROUND TIME:** [4hr rush] [8hr rush] [1 Day] [2-Day] [3-Day] [5-Day] [6-10 Day]

***Price confirmation of turnaround time is required

***Additional charges for rush analysis (please call marketing department for pricing details)

***Laboratory analysis may be subject to delay if credit terms are not met

2. **TYPE OF ANALYSIS:** [Bulk-PCM] [Air-PCM] [Lead] [Point Count] [Fungi: AOC, W-C, Bulk, Swab, Tape]

3. **DISPOSAL INSTRUCTIONS:** [Dispose of samples at EMC] / [Return samples to me at my expense]
 (If you do not indicate preference, EMC will dispose of samples 60 days from analysis.)

4. Project Name: Old Hidalgo County Administration Bldg. - 100 E. Cano, Edinburg, TX 78539
 P.O. Number: 122882 Project Number: ASF08-219-00

EMC SAMPLE #	CLIENT SAMPLE #	DATE & TIME SAMPLED	LOCATION/MATERIAL TYPE	Samples Accepted Yes / No	AIR SAMPLE INFO / COMMENTS		
					ON	OFF	FLOW RATE
76	76	9-25-8	Sink Under Coat white	Y N			
77	77		" "	Y N			
78	78		" "	Y N			
79	79		12"x12" FT (Blue) + Yellow Mastix	Y N			
80	80		" " "	Y N			
81	81		" " "	Y N			
82	82		2'x2' CT - Gray - Rough Surface	Y N			
83	83		" " "	Y N			
84	84		" " "	Y N			
85	85		2" Wrap / Canvas Top of Mastix of Black	Y N			
86	86		" " "	Y N			
87	87		" " "	Y N			
88	88		Black Mastix / silver wrap	Y N			
89	89		" " "	Y N			
90	90		" " "	Y N			

SPECIAL INSTRUCTIONS:

Sample Collector: (Print) AL (Signature) [Signature]

Relinquished by: [Signature] Date/Time: 9-25-8 Received by: [Signature] Date/Time: 9/26/08

Relinquished by: Diana Federico Date/Time: 9/26/08 Received by: [Signature] Date/Time: 9/29/08

Relinquished by: _____ Date/Time: _____ Received by: _____ Date/Time: _____

** In the event of any dispute between the above parties for these services or otherwise, parties agree that jurisdiction and venue will be in Phoenix, Arizona and prevailing party will be entitled to attorney's fees and court costs.

CHAIN OF CUSTODY

EMC Laboratories
 9830 S. 51ST St., Ste B-109
 Phoenix, AZ 85044
 (800) 362-3373 Fax (480) 893-1726

LAB#: _____
 TAT: _____
 Rec'd: 68736
 EMC USE ONLY

COMPANY NAME: RABA KISTNER
800 E. Hackberry
McAllen, TX 78501
 CONTACT: Al Gurrola
 Phone/Fax: (956) 682-5332 / (956) 682-5487
 Email: agurrola@rkci.com

BILL TO: _____
 (If Different Location)

Now Accepting: VISA - MASTERCARD Price Quoted: \$ _____ / Sample \$ _____ / Layers

COMPLETE ITEMS 1-4: (Failure to complete any items may cause a delay in processing or analyzing your samples)

1. **TURNAROUND TIME:** [4hr rush] [8hr rush] [1-Day] [2-Day] [3-Day] [5-Day] [6-10 Day]

***Prior confirmation of turnaround time is required
 ***Additional charges for rush analysis (please call marketing department for pricing details)
 ***Laboratory analysis may be subject to delay if credit terms are not met

2. **TYPE OF ANALYSIS:** [BULK-PLM] [Air-PCM] [Lead] [Point Count] [Fungi: AOC, W-C, Bulk, Swab, Tape]

3. **DISPOSAL INSTRUCTIONS:** [Dispose of samples at EMC] / [Return samples to me at my expense]
 (If you do not indicate preference, EMC will dispose of samples 60 days from analysis.)

4. Project Name: Old Hidalgo County Administration Bldg - 100 E. Cano, Edinburg, TX 78539
 P.O. Number: 122 882 Project Number: ASF08-219-00

EMC SAMPLE #	CLIENT SAMPLE #	DATE & TIME SAMPLED	LOCATION/MATERIAL TYPE	Samples Accepted Yes / No	AIR SAMPLE INFO / COMMENTS		
					ON	OFF	FLOW RATE
91	91	9-25-8	White Mud/tan Concrete - Culvert square (south side)	Y	N		
92	92		" " "	Y	N		
93	93		" " "	Y	N		
94	94		Wall Board, TC/Texture (fine) (original)	Y	N		
95	95		" " "	Y	N		
96	96		" " "	Y	N		
97	97		4" Cure Base Matrix (Dark Brown/tan)	Y	N		
98	98		" " "	Y	N		
99	99		" " "	Y	N		
100	100		12"x12" PT Brown+Yellow/Black Matrix (on left behind)	Y	N		
101	101		" " "	Y	N		
102	102		" " "	Y	N		
103	103		Wall Board, TC+Texture (New)	Y	N		
104	104		" " "	Y	N		
105	105		" " "	Y	N		

SPECIAL INSTRUCTIONS: _____
 Sample Collector: (Print) M G. (Signature) [Signature]
 Relinquished by: [Signature] Date/Time: 9-25-8 Received by: Diana Federico Date/Time: 9/26/08
 Relinquished by: Diana Federico Date/Time: 9/26/08 Received by: [Signature] Date/Time: 9/29/08
 Relinquished by: _____ Date/Time: _____ Received by: _____ Date/Time: _____

** In the event of any dispute between the above parties for these services or otherwise, parties agree that jurisdiction and venue will be in Phoenix, Arizona and prevailing party will be entitled to attorney's fees and court costs.

CHAIN OF CUSTODY

EMC Laboratories
 9830 S. 51ST St., Ste B-109
 Phoenix, AZ 85044
 (800) 362-3373 Fax (480) 893-1726

TAT: 68736
 Rec'd:
 EMC USE ONLY

COMPANY NAME: RABA KISTNER
800 E. Hackberry
McAllen, TX 78501
 CONTACT: Al Gurrola
 Phone/Fax: (956) 682-5332 / (956) 682-5487
 Email: agurrola@rkci.com

BILL TO: _____ (If Different Location)

Now Accepting: VISA - MASTERCARD Price Quoted: \$ _____ / Sample \$ _____ / Layers

COMPLETE ITEMS 1-4: (Failure to complete any items may cause a delay in processing or analyzing your samples)

1. **TURNAROUND TIME:** [4hr rush] [8hr rush] [1-Day] [2-Day] [3-Day] [5-Day] [6-10 Day]

--- Prior confirmation of turnaround time is required
 --- Additional charges for rush analysis (please call marketing department for pricing details)
 --- Laboratory analysis may be subject to delay if credit terms are not met

2. **TYPE OF ANALYSIS:** [Bulk-PLM] [Air-PCM] [Lead] [Point Count] [Fungi: AOC, W-C, Bulk, Swab, Tape]

3. **DISPOSAL INSTRUCTIONS:** [Dispose of samples at EMC] / [Return samples to me at my expense]
 (If you do not indicate preference, EMC will dispose of samples 60 days from analysis.)

4. Project Name: Old Hidalgo County Administration Bldg - 100 E. Can. Edinburg, TX 78539
 P.O. Number: 122882 Project Number: ASF08-219-00

EMC SAMPLE #	CLIENT SAMPLE #	DATE & TIME SAMPLED	LOCATION/MATERIAL TYPE	Samples Accepted Yes/No	AIR SAMPLE INFO / COMMENTS		
					ON	OFF	FLOW RATE
<u>106</u>	<u>106</u>	<u>9-25-8</u>	<u>12"X12" FT (Base) + Yellow + Black Mastic</u>	<u>Y</u>	<u>N</u>		
<u>107</u>	<u>107</u>	}	<u>" " "</u>	<u>Y</u>	<u>N</u>		
<u>108</u>	<u>108</u>		<u>" " "</u>	<u>Y</u>	<u>N</u>		
<u>109</u>	<u>109</u>		<u>Core base Mastic - Black/brown / tan</u>	<u>Y</u>	<u>N</u>		
<u>110</u>	<u>110</u>		<u>" " "</u>	<u>Y</u>	<u>N</u>		
<u>111</u>	<u>111</u>		<u>" " "</u>	<u>Y</u>	<u>N</u>		
<u>112</u>	<u>112</u>		<u>Wall Board, TC + Texture</u>	<u>Y</u>	<u>N</u>		
<u>113</u>	<u>113</u>		<u>" " "</u>	<u>Y</u>	<u>N</u>		
<u>114</u>	<u>114</u>		<u>" " "</u>	<u>Y</u>	<u>N</u>		
<u>115</u>	<u>115</u>		<u>12"X12" FT + Yellow Mastic -</u>	<u>Y</u>	<u>N</u>	<u>3rd Floor</u>	
<u>116</u>	<u>116</u>		<u>" " "</u>	<u>Y</u>	<u>N</u>		
<u>117</u>	<u>117</u>	<u>" " "</u>	<u>Y</u>	<u>N</u>			
<u>118</u>	<u>118</u>	<u>Wall Board TC / Texture (original)</u>	<u>Y</u>	<u>N</u>			
<u>119</u>	<u>119</u>	<u>" " "</u>	<u>Y</u>	<u>N</u>			
<u>120</u>	<u>120</u>	<u>" " "</u>	<u>Y</u>	<u>N</u>			

SPECIAL INSTRUCTIONS:

Sample Collector: (Print) M (Signature) [Signature]
 Relinquished by: [Signature] Date/Time: 9-25-8 Received by: Diana Federico Date/Time: 9/26/08
 Relinquished by: Diana Federico Date/Time: 9/26/08 Received by: [Signature] Date/Time: 9/29/08
 Relinquished by: _____ Date/Time: _____ Received by: _____ Date/Time: _____

In the event of any dispute between the above parties for these services or otherwise, parties agree that jurisdiction and venue will be in Phoenix, Arizona and prevailing party will be entitled to attorney's fees and court costs.

CHAIN OF CUSTODY

EMC Laboratories
 9830 S. 51ST St., Ste B-109
 Phoenix, AZ 85044
 (800) 362-3373 Fax (480) 893-1726

LAB#: _____
 TAT: 68736
 Rec'd: _____
 EMC USE ONLY

COMPANY NAME: RABA KISTNER
800 E. Hackberry
McAllen, TX 78501
 CONTACT: Al Gurrola
 Phone/Fax: (956) 682-5332 / (956) 682-5487
 Email: agurrola@rkci.com

BILL TO: _____ (If Different Location)

Now Accepting: VISA - MASTERCARD Price Quoted: \$ _____ / Sample \$ _____ / Layers

COMPLETE ITEMS 1-4: (Failure to complete any items may cause a delay in processing or analyzing your samples)

1. TURNAROUND TIME: [4hr rush] [8hr rush] [1-Day] [2-Day] [3-Day] [5-Day] [6-10 Day]

***Prior confirmation of turnaround time is required
 ***Additional charges for rush analysis (please call marketing department for pricing details)
 ***Laboratory analysis may be subject to delay if credit terms are not met

2. TYPE OF ANALYSIS: [EMC-PLM] [Air-PCM] [Lead] [Point Count] [Fungi: AOC, W-C, Bulk, Swab, Tape]

3. DISPOSAL INSTRUCTIONS: [Dispose of samples at EMC] / [Return samples to me at my expense]
 (If you do not indicate preference, EMC will dispose of samples 60 days from analysis.)

4. Project Name: Old Hidalgo County Adm Bldg - 100 E. Cano Edinburg Texas 78539
 P.O. Number: 122882 Project Number: ASF08-219-00

EMC SAMPLE #	CLIENT SAMPLE #	DATE & TIME SAMPLED	LOCATION/MATERIAL TYPE	Samples Accepted Yes / NO	AIR SAMPLE INFO / COMMENTS		
					ON	OFF	FLOW RATE
121	121	9-25-8	8" Paper Wrap / Tape Corner / Masked (White)	Y N			3rd Flr
122	122		" " "	Y N			
123	123		" " "	Y N			
124	124		4" x 8" Wrap Tape Corner / Masked (White)	Y N			Mechanical Room
125	125		" " "	Y N			
126	126		" " "	Y N			
127	127		Wall Board, TC / Texture	Y N			2nd
128	128		" " "	Y N			"
129	129		" " "	Y N			Hard W. Wall 1 st Floor
130	130		Cloth Corner Wrap - Old Yellow	Y N			1 st Floor (South)
131	131		" " "	Y N			
132	132		" " "	Y N			
				Y N			
				Y N			

SPECIAL INSTRUCTIONS:

Sample Collector: (Print) Al G. (Signature) [Signature]
 Relinquished by: [Signature] Date/Time: 9-25-8 Received by: Diana Federica Date/Time: 9/26/08
 Relinquished by: Diana Federica Date/Time: 9/26/08 Received by: [Signature] Date/Time: 9/29/08
 Relinquished by: _____ Date/Time: _____ Received by: _____ Date/Time: _____

* In the event of any dispute between the above parties for these services or otherwise, parties agree that jurisdiction and venue will be in Phoenix, Arizona and prevailing party will be entitled to attorney's fees and court costs.



ATTACHMENT C

R-K LICENSE AND CERTIFICATIONS



TEXAS DEPARTMENT OF STATE HEALTH SERVICES

RABA-KISTNER CONSULTANTS INC

is certified to perform as a

Asbestos Consultant Agency

in the State of Texas within the purview of Texas Occupations Code, chapter 1954, so long as this license is not suspended or revoked and is renewed according to the rules adopted by the Texas Board of Health.

A handwritten signature in cursive script, appearing to read "David Lahey, M.D.", written over a horizontal line.

DAVID LAKEY, M.D.
COMMISSIONER OF HEALTH


License Number: 100037

Control Number: 96123

Expiration Date: 5/12/2010

(Void After Expiration Date)

VOID IF ALTERED NON-TRANSFERABLE

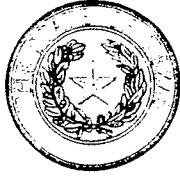

TEXAS DEPARTMENT OF STATE HEALTH SERVICES

DAVID L. LAKEY, M.D.
COMMISSIONER

1100 West 49th Street • Austin, Texas 78756
P.O. Box 149347 • Austin, Texas 78714-9347
1-888-963-7111 • www.dshs.state.tx.us
TTY: 1-800-735-2989

MARCH 18, 2008


MICHAEL COSGROVE
200 HIGH POINT TRAIL
DRIPPING SPRING, TX 78620

This is to verify that the individual shown below holds a valid credential to practice as an ASBESTOS INDIVIDUAL CONSULTANT in the State of Texas.

NAME: MICHAEL COSGROVE
LICENSE NUMBER: 105473
LICENSE TYPE: ASBESTOS INDIVIDUAL CONSULTANT
EXPIRATION DATE: 3/15/2010

If you have any questions, please contact us by phone at 512-834-6600, by fax at 512/834-6614. We encourage you to visit our website at <http://www.dshs.state.tx.us> for frequently updated information, including rules, laws, publications and forms. You may also verify a credential through this website.

Environmental & Sanitation Licensing Group

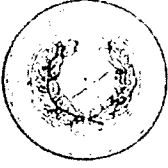

TEXAS DEPARTMENT OF STATE HEALTH SERVICES

DAVID L. LAKEY, M.D.
COMMISSIONER

1100 West 49th Street • Austin, Texas 78756
P.O. Box 149347 • Austin, Texas 78714-9347
1-888-963-7111 • www.dshs.state.tx.us
TTY: 1-800-735-2989

JULY 10, 2008

ALVARO GURROLA
7012 S ST MARIE DR
PHARR, TX 78577

This is to verify that the individual shown below holds a valid credential to practice as an ASBESTOS INDIVIDUAL MANAGEMENT PLANNER in the State of Texas.

NAME: ALVARO GURROLA
LICENSE TYPE: ASBESTOS INDIVIDUAL MANAGEMENT PLANNER
LICENSE NUMBER: 205447
CONTROL NUMBER: 95520
EXPIRATION DATE: 7/19/2010

If you have any questions, please contact us by phone at 512-834-6600, by fax at 512/834-6614. We encourage you to visit our website at <http://www.dshs.state.tx.us> for frequently updated information, including rules, laws, publications and forms. You may also verify a credential through this website.

Environmental & Sanitation Licensing Group